



**Star
Home
Inspection Services**

Home Inspection Report

601 NE Burning Tree St Lees Summit, MO 64064

Inspection Date: 04/05/2010

Prepared For: Gail Welchon

Prepared By: Star Home Inspection Services LLC
705B SE Melody Lane, Suite 124
Lee's Summit, MO 64063
(816) 554-1110
(816) 554-2135 Fax

Report Number: 04052010-3L

Inspector: Larry Carter



Table Of Contents

REPORT OVERVIEW	3
STRUCTURE	7
ROOFING	9
EXTERIOR	12
ELECTRICAL	16
HEATING	20
COOLING / HEAT PUMPS	21
INSULATION / VENTILATION	22
PLUMBING	24
INTERIOR	26
APPLIANCES	29
FIREPLACES / WOOD STOVES	30

Report Overview

THE HOUSE IN PERSPECTIVE

This is an average quality home. As with all homes, ongoing maintenance is required and improvements to the systems of the home will be needed over time. *The improvements that are recommended in this report are not considered unusual for a home of this age and location.* Please remember that there is no such thing as a perfect home.

CONVENTIONS USED IN THIS REPORT

For your convenience, the following conventions have been used in this report.

Major Concern: a system or component which is considered significantly deficient or is unsafe. Significant deficiencies need to be corrected and, except for some safety items, are likely to involve significant expense.

Safety Issue: denotes a condition that is unsafe and in need of prompt attention.

Repair: denotes a system or component which is missing or which needs corrective action to assure proper and reliable function.

Improve: denotes improvements which are recommended but not required.

Monitor: denotes a system or component needing further investigation and/or monitoring in order to determine if repairs are necessary.

Please note that those observations listed under “Discretionary Improvements” are not essential repairs, but represent logical long term improvements.

- For the purpose of this report, it is assumed that the house faces north.

IMPROVEMENT RECOMMENDATION HIGHLIGHTS / SUMMARY

The following is a synopsis of the potentially significant improvements that should be budgeted for over the short term. Other significant improvements, outside the scope of this inspection, may also be necessary. Please refer to the body of this report for further details on these and other recommendations.

All issues found in this report should be addressed with the appropriate parties to make any improvements, corrections or repairs necessary. All improvements, corrections and repairs should meet the satisfaction of the client named on this report and the inspection agreement associated with this report prior to closing. This report and the findings listed herein are intended for the client only and is not transferable without a signed written agreement.

Any comments on the issues listed are made by the seller. If no comments the item should be considered “AS IS”

Foundation

- **Monitor:** The basement floor slab has typical cracks usually the result of shrinkage and/or settling of the slab as it cures. Shrinkage cracks are very common and are not normally a concern.

Floors

- **Monitor:** Construction mold was visible on some floor joists. This is mold that grows on the lumber while lying in the weather during construction. Most homes have some level of this mold and it goes dormant once removed from the elements and normally does not present any problems.

Sloped Roofing

- **Recommend:** Exposed nail heads were observed in the roofing shingles and/or ridge caps, vents and flashjions. All exposed nail heads should be caulked to reduce the potential of leaks.

Chimneys

- **Repair:** The masonry chimney needs re-pointing (replacing the mortar between the bricks) and the replacement of one corner brick to avoid further damage.
- **Repair:** The cap of the masonry chimney is cracked and/or damaged. This should be repaired to prevent further damage to the chimney.

Main Panel

- **Repair:** Oversized breaker within the main distribution panel for the air condition should be replaced. The data plate on the unit specifies a maximum breaker size of 35 Amps and the one in the panel is 50 Amps.
- **Repair:** Any openings in the main panel should be covered.
- **Repair:** One cable in the electrical panel is not connected to a breaker and the wires are not capped.
- **Repair:** Cable clamps (sometimes referred to as bushings or grommets) are required where wiring passes into the main distribution panel. Cable clamps serve to protect the wiring from the metal edges of the panel openings.

Outlets

- **Repair:** Outlets on the southwest corner of the house and in the living room are inoperative. These outlets and circuits should be investigated and repaired as needed.
- **Repair:** An outlet in the living room has reversed polarity (i.e. it is wired backwards). This outlet and the circuit should be investigated and repaired as necessary.
- **Repair:** Ungrounded 3-prong outlets on the rear of the house marked with blue tape should be repaired. In some cases a ground wire may be present in the electrical box and simply needs to be connected. If no ground is present "repair" can be as simple as replacing with two-holed outlets.
- **Repair:** Missing outlet cover plates in the basement bath and on the basement support pole should be replaced to avoid a shock hazard.

Switches

- **Monitor, Repair:** The function of the light switches in the living room and master bedroom marked with blue tape is unknown.
- **Monitor, Repair:** One switch is missing on the double switch by the garage overhead door.

Lights

- **Repair:** The exterior garage light is inoperative. If the bulbs are not blown, the circuit should be repaired.
- **Monitor, Repair:** The laundry room light fixture is missing the glass cover. Repair is discretionary.

Supply Air Ductwork

- **Repair:** Missing vent register(s) should be replaced.

Attic / Roof

- **Monitor:** While in the attic water stains were observed on the lower sections of the furnace flue. The insulation below the elbow also showed signs of past moisture. It appears that rain blew in under the rain cap and came down the interior of the flue until it got to the first joint where it then transferred to the outside surface and dripped off the elbow. This is a common condition in 80% of homes but very seldom is enough to penetrate completely through the insulation to the drywall below. Monitor for any additional wetness after rains.
- **Repair:** The old exhaust fan is hanging by the conduit in the attic. The fan should be removed.

Water Heater

- **Monitor:** Water heaters have a typical life expectancy of 7 to 12 years. The existing unit is approaching or has exceeded this age range. One cannot predict with certainty when replacement will become necessary.

Plumbing Fixtures

- **Repair:** The basement sink drain plug is inoperative and needs repair.
- **Repair:** The hallway bathroom toilet is loose. The wax seal should be replaced and toilet better secured.
- **Improve:** Cracked, deteriorated and/or missing shower stall grout and caulk in the master bedroom shower needs minor improvements.
- **Improve:** Cracked, deteriorated and/or missing bathtub and shower enclosure caulk in the hallway bathroom could be improved along the floor. With vinyl flooring it's recommended a quarter round molding be installed to prevent the vinyl from curling and pulling the caulking loose.
- **Improve:** The hallway bathroom vanity needs some minor caulking improvements.

Wall / Ceiling Finishes

- **Monitor:** Water staining was noted on the living room ceiling.
- **Monitor, Repair:** The textured ceiling in the garage is peeling. This is most likely caused from condensation from the duct and is difficult to control in a garage when humidity is high and the doors are open.
- **Monitor:** Typical drywall and/or plaster flaws were observed that could include loose tape, minor cracks, rough seams, peeling paper, nail popping, minor patching, loose or bulging plaster, etc. Any repairs would be discretionary.
- **Monitor, Repair:** The painting in the master bedroom bath hallway is incomplete.

Windows

- **Monitor, Repair:** It may be desirable to replace window screens where missing.

Doors

- **Monitor, Repair:** Door to the northeast bedroom should be adjusted as necessary to latch properly.
- **Monitor, Repair:** The screen for the sliding glass doors are missing.

Basement Leakage

- **Monitor:** No evidence of moisture penetration was visible in the basement at the time of the inspection. *It should be understood that it is impossible to predict whether moisture penetration will pose a problem in the future.* The vast majority of basement leakage problems are the result of insufficient control of storm water at the surface. The ground around the house should be sloped to encourage water to flow away from the foundation. Gutters and downspouts should act to collect roof water and drain the water at least five (5) feet from the foundation or into a functional storm sewer. Downspouts that are clogged or broken below grade level, or that discharge too close to the foundation are the most common source of basement leakage. Please refer to the Roofing and Exterior sections of the report for more information.

In the event that basement leakage problems are experienced, lot and roof drainage improvements should be undertaken as a first step. Please beware of contractors who recommend expensive solutions. Excavation, damp-proofing and/or the installation of drainage tiles should be a last resort. In some cases, however, it is necessary. Your plans for using the basement may also influence the approach taken to curing any dampness that is experienced. If another rain occurs before closing, it's recommended the basement be viewed again for any signs of moisture penetration.

Fireplaces

- **Recommend:** Due to the notes made on the chimney in the Roofing section, it's recommended the fireplace and chimney be inspected and cleaned prior to operation.

THE SCOPE OF THE INSPECTION

All components designated for inspection in the ASHI® Standards of Practice are inspected, except as may be noted in the "Limitations of Inspection" sections within this report.

It is the goal of the inspection to put a home buyer in a better position to make a buying decision. Not all improvements will be identified during this inspection. Unexpected repairs should still be anticipated. The inspection should not be considered a guarantee or warranty of any kind.

This inspection is visual only. A representative sample of building components are viewed in areas that are accessible at the time of the inspection. No destructive testing or dismantling of building components is performed.

Please refer to the pre-inspection contract for a full explanation of the scope of the inspection.

WEATHER CONDITIONS

Dry weather conditions prevailed at the time of the inspection.

The estimated outside temperature was 68 degrees F.

RECENT WEATHER CONDITIONS

Wet weather conditions have been experienced in the days leading up to the inspection.

Structure

DESCRIPTION OF STRUCTURE

Foundation:	•Poured Concrete •Basement Configuration •60% Of Foundation Was Not Visible From Inside Due To Finished Walls and/or Storage
Columns:	•Steel
Floor Structure:	•Wood Joist
Wall Structure:	•Wood Frame
Ceiling Structure:	•Joist •Rafters
Roof Structure:	•Rafters •Waferboard Sheathing

STRUCTURE OBSERVATIONS

Positive Attributes

The construction of the home is good quality. The materials and workmanship, where visible, are good. The visible joist spans appear to be within typical construction practices. The inspection did not discover evidence of substantial structural movement.

General Comments

No major defects were observed in the accessible structural components of the house. No repair to structural components is necessary at this time.

RECOMMENDATIONS / OBSERVATIONS

Foundation

- **Monitor:** The basement floor slab has typical cracks usually the result of shrinkage and/or settling of the slab as it cures. Shrinkage cracks are very common and are not normally a concern.

Floors

- **Monitor:** Construction mold was visible on some floor joists. This is mold that grows on the lumber while lying in the weather during construction. Most homes have some level of this mold and it goes dormant once removed from the elements and normally does not present any problems.



LIMITATIONS OF STRUCTURE INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions:

- Structural components concealed behind finished surfaces could not be inspected.
- Only a representative sampling of visible structural components were inspected.
- Furniture and/or storage restricted access to some structural components.
- Engineering or architectural services such as calculation of structural capacities, adequacy, or integrity are not part of a home inspection.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Roofing

DESCRIPTION OF ROOFING

Roof Covering:	•Asphalt Shingle
Roof Flashings:	•Metal
Chimneys:	•Masonry
Roof Drainage System:	•Aluminum •Downspouts discharge above & below grade
Skylights:	•None
Method of Inspection:	•Walked on roof

ROOFING OBSERVATIONS

Positive Attributes

The roof coverings are to be in generally good condition. The installation of the roofing materials has been performed in a professional manner. The quality of the installation is above average. Better than average quality materials have been employed as roof coverings. The steep pitch of the roof should result in a longer than normal life expectancy for roof coverings. Roof flashing details appear to be in good order. The gutters are clean.


General Comments

In all, the roof coverings show evidence of normal wear and tear for a home of this age.

RECOMMENDATIONS / OBSERVATIONS

Sloped Roofing

- **Recommend:** Exposed nail heads were observed in the roofing shingles and/or ridge caps, vents and flashjongs. All exposed nail heads should be caulked to reduce the potential of leaks.

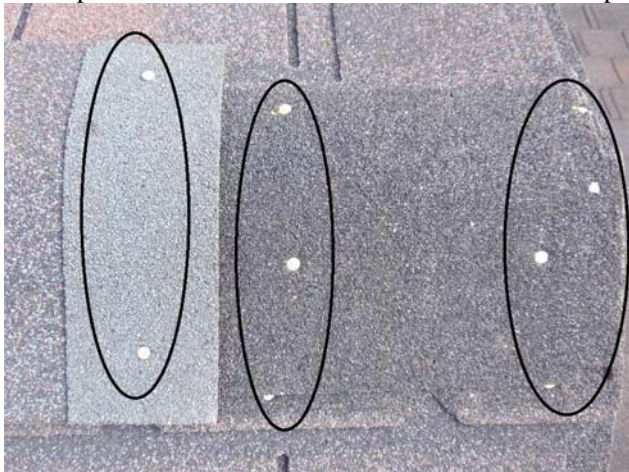



Chimneys

- **Repair:** The masonry chimney needs re-pointing (replacing the mortar between the bricks) and the replacement of one corner brick to avoid further damage.



- **Repair:** The cap of the masonry chimney is cracked and/or damaged. This should be repaired to prevent further damage to the chimney.



LIMITATIONS OF ROOFING INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions:

- Not all of the underside of the roof sheathing is inspected for evidence of leaks.
- Evidence of prior leaks may be disguised by interior finishes.
- Estimates of remaining roof life are approximations only and do not preclude the possibility of leakage. Leakage can develop at any time and may depend on rain intensity, wind direction, ice build up, and other factors.
- Antennae, chimney/flue interiors which are not readily accessible are not inspected and could require repair.
- Roof inspection may be limited by access, condition, weather, or other safety concerns.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Exterior

DESCRIPTION OF EXTERIOR

Wall Covering:	•Brick •Hardboard
Eaves, Soffits, And Fascias:	•Wood
Exterior Doors:	•Metal •Sliding Glass
Window/Door Frames and Trim:	•Wood
Entry Driveways:	•Concrete
Entry Walkways And Patios:	•Concrete
Porches, Decks, Steps, Railings:	•Wood
Overhead Garage Door(s):	•Metal •Automatic Opener Installed
Surface Drainage:	•Level Grade •Graded Away From House
Retaining Walls:	•None
Fencing:	•None

EXTERIOR OBSERVATIONS

Positive Attributes

The exterior siding that has been installed on the house is relatively low maintenance. Window frames are clad, for the most part, with a low maintenance material. The wood window frames are in generally good condition. The aluminum soffits and fascia are a low-maintenance feature of the exterior of the home. There is no significant wood/soil contact around the perimeter of the house, thereby reducing the risk of insect infestation or rot. The auto reverse mechanism on the overhead garage door responded properly to testing. This safety feature should be tested regularly as a door that doesn't reverse can injure someone or fall from the ceiling. Refer to the owner's manual or contact the manufacturer for more information. The driveway and walkways are in good condition. The garage appears to be fully insulated. The garage completely finished. Freeze resistant hose bibs (exterior faucets) have been installed.

General Comments

The exterior of the home is generally in good condition. The exterior of the home shows normal wear and tear for a home of this age.

RECOMMENDATIONS / OBSERVATIONS

Exterior Walls

- **Repair:** The gap between the siding and exterior brick wall on the northeast corner needs to be caulked or filled with mortar to prevent water damage



- **Repair:** The siding trim needs caulking improvements in localized areas to prevent water damage and rot. Picture was taken on the southeast corner above the lower roof.



Exterior Eaves

- **Monitor, Repair:** One soffit vent cover on the rear of the house is damaged. Repair is discretionary.



- **Repair:** The end of the fascia and soffit on the upper roof over the garage needs to be painted to prevent water damage and/or rot.



Garage

- **Monitor, Repair:** The base of the garage door frames should be caulked and painted at the concrete to prevent water damage and/or rot. (very minor).

- **Monitor:** The garage floor slab has typical cracks usually the result of shrinkage and/or settling of the slab as it cures. Shrinkage cracks are very common and are not normally a concern.

Lot Drainage

- **Monitor, Repair:** The grading should be improved and/or maintained to promote the flow of storm water away from the house. This can often be accomplished by the addition of top soil. The ground should slope away from the house at a rate of one inch per foot for at least the first five feet. At least eight (8) inches of clearance should be maintained between soil level and the bottom of exterior wall siding. *It should be understood that it is impossible to predict whether moisture penetration will pose a problem in the future. If another rain occurs before closing, it's recommended the basement be viewed again for any signs of moisture penetration.*

Porch

- **Repair:** The rear porch steps needs another coat of paint. It was also observed that the porches and steps are painted only on the outside surfaces.



- **Monitor, Repair:** The support posts for the rear steps are below the soil. This configuration is prone to rot. Raising above soil level is recommended. The potential of rot could already be present.



Driveway

- **Monitor:** The driveway has settled and cracked. Persisting movement may result in the need for repairs.

Landscaping

- **Monitor:** Tree branches should be kept trimmed away from the house to avoid damage to the building.



LIMITATIONS OF EXTERIOR INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions:

- A representative sample of exterior components was inspected rather than every occurrence of components.
- The inspection does not include an assessment of geological, geotechnical, or hydrological conditions, or environmental hazards.
- Screening, shutters, awnings, or similar seasonal accessories, fences, recreational facilities, outbuildings, seawalls, break-walls, docks, erosion control and earth stabilization measures are not inspected unless specifically agreed-upon and documented in this report.
- Storage in the garage restricted the inspection.
- Access below decks and/or porches was extremely limited.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Electrical

DESCRIPTION OF ELECTRICAL

Size of Electrical Service:	•120/240 Volt Main Service - Service Size: 200 Amps
Service Drop:	•Underground
Service Entrance Conductors:	•Aluminum
Service Equipment & Main Disconnects:	•Main Service Rating 200 Amps •Breakers •Located: Basement
Service Grounding:	•Aluminum-Insulated •Water Pipe Connection
Service Panel & Overcurrent Protection:	•Panel Rating: 200 Amp •Breakers •Located: Basement
Distribution Wiring:	•Copper
Wiring Method:	• Non-Metallic Cable "Romex"
Switches & Receptacles:	•Grounded
Ground Fault Circuit Interrupters:	•Bathroom(s)
Smoke Detectors:	•Present

ELECTRICAL OBSERVATIONS

Positive Attributes

The size of the electrical service is sufficient for typical single family needs. The electrical panel is well arranged and all fuses/breakers are properly sized relative to the wiring. Generally speaking, the electrical system is in good order. All outlets and light fixtures that were tested operated satisfactorily. The distribution of electricity within the home is good. All 3-prong outlets that were tested were appropriately grounded. Ground fault circuit interrupter (GFCI) devices have been provided in some areas of the home. These devices are extremely valuable, as they offer an extra level of shock protection. All GFCI's that were tested responded properly unless otherwise noted below. Dedicated 220 volt circuits have been provided for all 220 volt appliances within the home. All visible wiring within the home is copper. This is a good quality electrical conductor.


General Comments

Inspection of the electrical system revealed the need for typical, minor repairs. Although these are not costly to repair, they should be high priority for safety reasons. *Unsafe electrical conditions represent a shock hazard.* A licensed electrician should be consulted to undertake the repairs recommended below.

RECOMMENDATIONS / OBSERVATIONS

Main Panel

- **Repair:** Oversized breaker within the main distribution panel for the air condition should be replaced. The data plate on the unit specifies a maximum breaker size of 35 Amps and the one in the panel is 50 Amps.
- **Repair:** Any openings in the main panel should be covered.

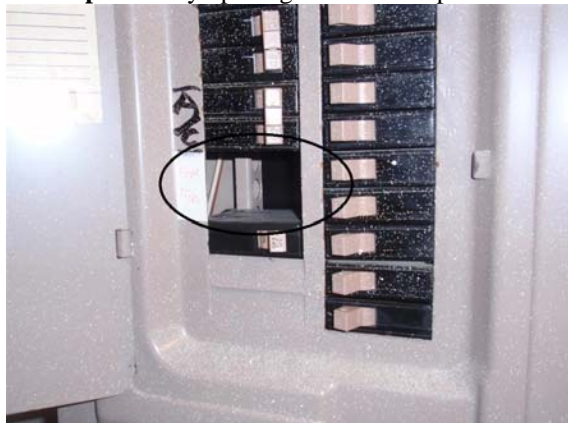

- **Repair:** One cable in the electrical panel is not connected to a breaker and the wires are not capped.



- **Repair:** Cable clamps (sometimes referred to as bushings or grommets) are required where wiring passes into the main distribution panel. Cable clamps serve to protect the wiring from the metal edges of the panel openings.



Outlets

- **Repair:** Outlets on the southwest corner of the house and in the living room are inoperative. These outlets and circuits should be investigated and repaired as needed.
- **Repair:** An outlet in the living room has reversed polarity (i.e. it is wired backwards). This outlet and the circuit should be investigated and repaired as necessary.
- **Repair:** Ungrounded 3-prong outlets on the rear of the house marked with blue tape should be repaired. In some cases a ground wire may be present in the electrical box and simply needs to be connected. If no ground is present “repair” can be as simple as replacing with two-holed outlets.

-
- **Repair:** Missing outlet cover plates in the basement bath and on the basement support pole should be replaced to avoid a shock hazard.



Switches

- **Monitor, Repair:** The function of the light switches in the living room and master bedroom marked with blue tape is unknown.
- **Monitor, Repair:** One switch is missing on the double switch by the garage overhead door.



Lights

- **Repair:** The exterior garage light is inoperative. If the bulbs are not blown, the circuit should be repaired.
- **Monitor, Repair:** The laundry room light fixture is missing the glass cover. Repair is discretionary.



LIMITATIONS OF ELECTRICAL INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions:

- Electrical components concealed behind finished surfaces are not inspected.
- Only a representative sampling of outlets and light fixtures were tested.
- Furniture and/or storage restricted access to some electrical components which may not be inspected.
- The inspection does not include remote control devices, alarm systems and components, low voltage wiring, systems, and components, ancillary wiring, systems, and other components which are not part of the primary electrical power distribution system.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Heating

DESCRIPTION OF HEATING

Energy Source:	•Gas
Heating System Type:	•Forced Air Furnace •Manufacturer: Trane •Serial Number: 8364N9X7G
Vents, Flues, Chimneys:	•Plastic
Heat Distribution Methods:	•Ductwork
Other Components:	•Humidifier

HEATING OBSERVATIONS

Positive Attributes

The heating system is in generally good condition. Adequate heating capacity is provided by the system. Heat distribution within the home is adequate. The heating system is controlled by a “set back” thermostat. This type of thermostat, if set up correctly, helps reduce heating costs.

General Comments

The heating system shows no visible evidence of major defects. No repairs to the heating system are necessary at this time.

RECOMMENDATIONS / OBSERVATIONS

Supply Air Ductwork

- **Repair:** Missing vent register(s) should be replaced.



LIMITATIONS OF HEATING INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions:

- The adequacy of heat supply or distribution balance is not inspected.
- The interior of flues or chimneys which are not readily accessible are not inspected.
- The furnace heat exchanger, humidifier, or dehumidifier, and electronic air filters are not inspected.
- Solar space heating equipment/systems are not inspected.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Cooling / Heat Pumps

DESCRIPTION OF COOLING / HEAT PUMPS

Energy Source:	•Electricity
Central System Type:	•Air Cooled Central Air Conditioning •Manufacturer: Trane •Serial Number: 8164YF94F
Size of Circuit:	•Circuit Size: Minimum Circuit Size 21 Amps/Maximum Circuit Breaker Size 35 Amps •Breaker Size In Main Panel: 50 Amps
Through-Wall Equipment:	•Not Present

COOLING / HEAT PUMPS OBSERVATIONS

Positive Attributes

The capacity and configuration of the system should be sufficient for the home. This is a relatively new system that should have many years of useful life remaining. Regular maintenance will, of course, be necessary. The location of the return air vents is well suited to air conditioning. The system responded properly to operating controls.

General Comments

The system shows no visible evidence of major defects. No repairs are necessary at this time.

RECOMMENDATIONS / OBSERVATIONS

LIMITATIONS OF COOLING / HEAT PUMPS INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions:

- Window mounted air conditioning units are not inspected.
- The cooling supply adequacy or distribution balance are not inspected.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Insulation / Ventilation

DESCRIPTION OF INSULATION / VENTILATION

Attic Insulation:	•Loose Fiberglass/Mineral Wool in Main Attic
Exterior Wall Insulation:	•Not Visible
Basement Wall Insulation:	•Fiberglass on Basement Walls
Floor Cavity Insulation:	
Vapor Retarders:	•Plastic
Roof Ventilation:	•Roof Vents •Soffit Vents
Exhaust Fan/vent Locations:	•Bathroom •Dryer

INSULATION / VENTILATION OBSERVATIONS

Positive Attributes

Insulation levels are typical for a home of this age and construction.

General Comments

Upgrading insulation levels in a home is an improvement rather than a necessary repair.

RECOMMENDATIONS / ENERGY SAVING SUGGESTIONS

Attic / Roof

- **Monitor:** While in the attic water stains were observed on the lower sections of the furnace flue. The insulation below the elbow also showed signs of past moisture. It appears that rain blew in under the rain cap and came down the interior of the flue until it got to the first joint where it then transferred to the outside surface and dripped off the elbow. This is a common condition in 80% of homes but very seldom is enough to penetrate completely through the insulation to the drywall below. Monitor for any additional wetness after rains.



- **Repair:** The old exhaust fan is hanging by the conduit in the attic. The fan should be removed.



LIMITATIONS OF INSULATION / VENTILATION INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions:

- Insulation/ventilation type and levels in concealed areas are not inspected. Insulation and vapor barriers are not disturbed and no destructive tests (such as cutting openings in walls to look for insulation) are performed.
- Potentially hazardous materials such as Asbestos and Urea Formaldehyde Foam Insulation (UFFI) cannot be positively identified without a detailed inspection and laboratory analysis. This is beyond the scope of the inspection.
- An analysis of indoor air quality is not part of our inspection unless explicitly contracted-for and discussed in this or a separate report.
- Any estimates of insulation R values or depths are rough average values.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Plumbing

DESCRIPTION OF PLUMBING

Water Supply Source:	•Public Water Supply
Service Pipe to House:	•Copper
Main Water Valve Location:	•Front Wall of Basement
Interior Supply Piping:	•Copper
Waste System:	•Public Sewer System
Drain, Waste, & Vent Piping:	•Plastic
Water Heater:	•Gas •Approximate Capacity (in gallons): 40 •Manufacturer: Bradford White •Serial Number: TG6205246
Fuel Shut-Off Valves:	•Natural Gas Main Valve At Meter
Other Components:	•Sump Pump

PLUMBING OBSERVATIONS

Positive Attributes

The plumbing system is in generally good condition. The piping system within the home, for both supply and waste, is a good quality system. The water pressure supplied to the fixtures is reasonably good. A typical drop in flow was experienced when two fixtures were operated simultaneously. The plumbing fixtures appear to have been well-maintained.

RECOMMENDATIONS / OBSERVATIONS

Water Heater

- **Monitor:** Water heaters have a typical life expectancy of 7 to 12 years. The existing unit is approaching or has exceeded this age range. One cannot predict with certainty when replacement will become necessary.

Plumbing Fixtures


- **Repair:** The basement sink drain plug is inoperative and needs repair.
- **Repair:** The hallway bathroom toilet is loose. The wax seal should be replaced and toilet better secured.
- **Improve:** Cracked, deteriorated and/or missing shower stall grout and caulk in the master bedroom shower needs minor improvements.



- **Improve:** Cracked, deteriorated and/or missing bathtub and shower enclosure caulk in the hallway bathroom could be improved along the floor. With vinyl flooring it's recommended a quarter round molding be installed to prevent the vinyl from curling and pulling the caulking loose.



- **Improve:** The hallway bathroom vanity needs some minor caulking improvements.

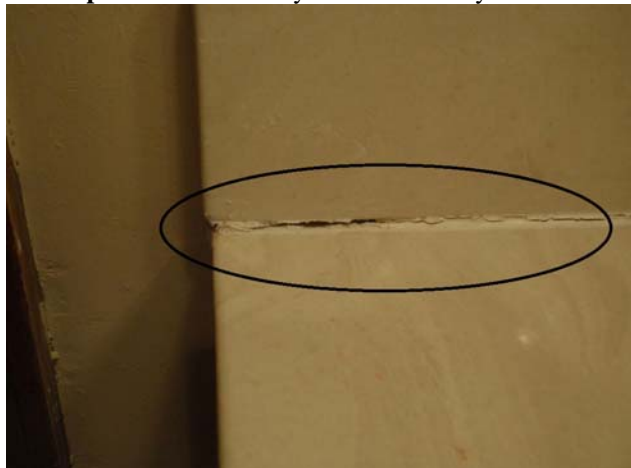

LIMITATIONS OF PLUMBING INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions:

- Portions of the plumbing system concealed by finishes and/or storage (below sinks, etc.), below the structure, or beneath the ground surface are not inspected.
- Water quantity and water quality are not tested unless explicitly contracted-for and discussed in this or a separate report.
- Clothes washing machine connections are not inspected.
- Interiors of flues or chimneys which are not readily accessible are not inspected.
- Water conditioning systems, solar water heaters, fire and lawn sprinkler systems, and private waste disposal systems are not inspected unless explicitly contracted-for and discussed in this or a separate report.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Interior

DESCRIPTION OF INTERIOR

Wall And Ceiling Materials:	•Drywall
Floor Surfaces:	•Carpet •Tile •Vinyl/Resilient
Window Type(s) & Glazing:	•Double/Single Hung •Sliders •Thermal Pane
Doors:	•Wood-Hollow Core •Sliding Glass

INTERIOR OBSERVATIONS

General Condition of Interior Finishes

On the whole, the interior finishes of the home are in above average condition. Typical minor flaws were observed in some areas.

General Condition of Windows and Doors

The majority of the doors and windows are good quality. The windows have, for the most part, been well-maintained.



General Condition of Floors

The floors of the home are relatively level and walls are relatively plumb.


RECOMMENDATIONS / OBSERVATIONS

Wall / Ceiling Finishes

- **Monitor:** Water staining was noted on the living room ceiling.

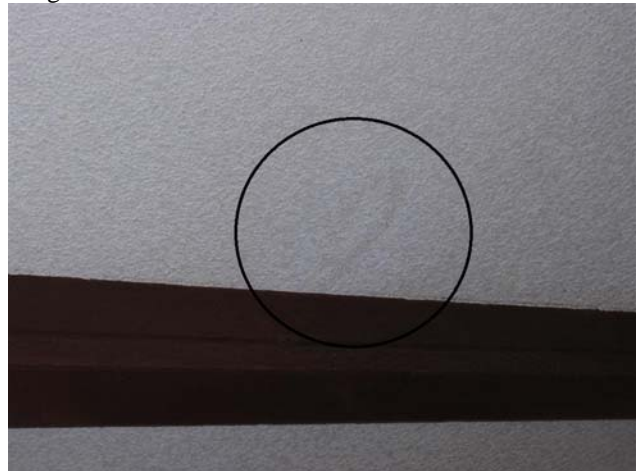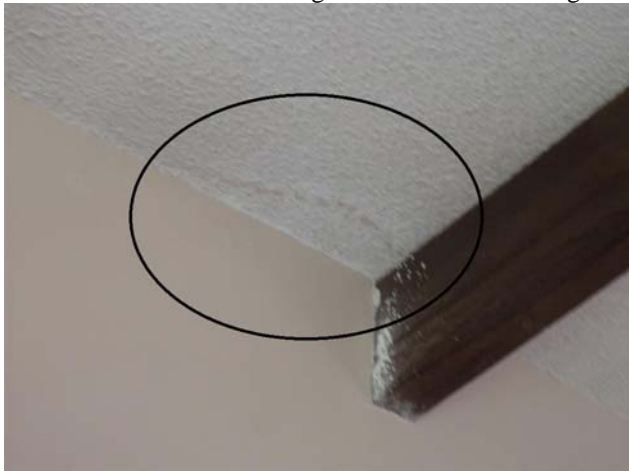

- **Monitor, Repair:** The textured ceiling in the garage is peeling. This is most likely caused from condensation from the duct and is difficult to control in a garage when humidity is high and the doors are open.

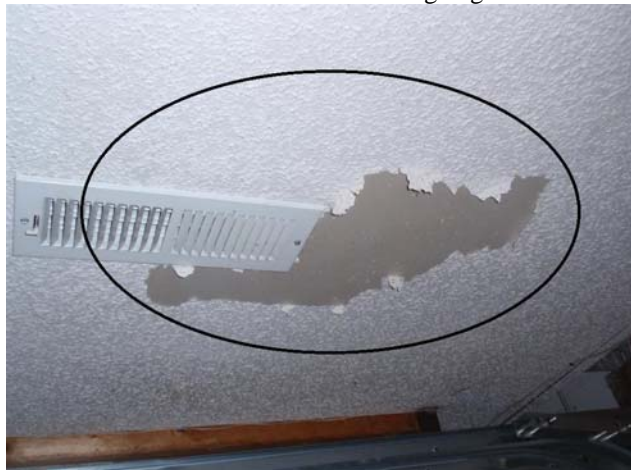

- **Monitor:** Typical drywall and/or plaster flaws were observed that could include loose tape, minor cracks, rough seams, peeling paper, nail popping, minor patching, loose or bulging plaster, etc. Any repairs would be discretionary.
- **Monitor, Repair:** The painting in the master bedroom bath hallway is incomplete.



Windows

- **Monitor, Repair:** It may be desirable to replace window screens where missing.

Doors

- **Monitor, Repair:** Door to the northeast bedroom should be adjusted as necessary to latch properly.
- **Monitor, Repair:** The screen for the sliding glass doors are missing.

Basement Leakage

- **Monitor:** No evidence of moisture penetration was visible in the basement at the time of the inspection. ***It should be understood that it is impossible to predict whether moisture penetration will pose a problem in the future.*** The vast majority of basement leakage problems are the result of insufficient control of storm water at the surface. The ground around the house should be sloped to encourage water to flow away from the foundation. Gutters and downspouts should act to collect roof water and drain the water at least five (5) feet from the foundation or into a functional storm sewer. Downspouts that are clogged or broken below grade level, or that discharge too close to the foundation are the most common source of basement leakage. Please refer to the Roofing and Exterior sections of the report for more information.

In the event that basement leakage problems are experienced, lot and roof drainage improvements should be undertaken as a first step. Please beware of contractors who recommend expensive solutions. Excavation, damp-proofing and/or the installation of drainage tiles should be a last resort. In some cases, however, it is necessary. Your plans for using the

basement may also influence the approach taken to curing any dampness that is experienced. If another rain occurs before closing, it's recommended the basement be viewed again for any signs of moisture penetration.

Discretionary Improvements

Install new exterior lock sets upon taking possession of the home.

LIMITATIONS OF INTERIOR INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions

- Furniture, storage, appliances and/or wall hangings are not moved to permit inspection and may block defects.
- Carpeting, window treatments, central vacuum systems, household appliances, recreational facilities, paint, wallpaper, and other finish treatments are not inspected.
- Recent renovations and/or interior painting concealed historical evidence.
- Portions of the foundation walls were concealed from view.
- The adequacy of the fireplace draw cannot be determined during a visual inspection.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Appliances

DESCRIPTION OF APPLIANCES

Appliances Tested:	•Electric Range •Microwave Oven •Dishwasher •Waste Disposer •Refrigerator
Laundry Facility:	•Dryer Vented to Building Exterior •Hot and Cold Water Supply for Washer •Waste Standpipe for Washer
Other Components Tested:	•Door Bell

APPLIANCES OBSERVATIONS

Positive Attributes

The appliances are to be in generally good condition. All appliances that were tested responded satisfactorily. The kitchen and laundry facilities are well organized. The kitchen cabinetry is above average quality. The appliances that have been installed in the kitchen are good quality.

RECOMMENDATIONS / OBSERVATIONS

LIMITATIONS OF APPLIANCES INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions

- Thermostats, timers and other specialized features and controls are not tested.
- The temperature calibration, functionality of timers, effectiveness, efficiency and overall performance of appliances is outside the scope of this inspection.

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.

Fireplaces / Wood Stoves

DESCRIPTION OF FIREPLACES / WOOD STOVES

Fireplaces:

•Masonry Firebox •Gas

Vents, Flues, Chimneys:

•Masonry Chimney-Lined

FIREPLACES / WOOD STOVES OBSERVATIONS

General Comments

On the whole, the fireplace and it's components were found to be in average condition. Typical flaws were observed in some areas.

RECOMMENDATIONS / OBSERVATIONS

Fireplaces

- **Recommend:** Due to the notes made on the chimney in the Roofing section, it's recommended the fireplace and chimney be inspected and cleaned prior to operation.

LIMITATIONS OF FIREPLACES / WOOD STOVES INSPECTION

As we have discussed and as described in your inspection contract, this is a visual inspection limited in scope by (but not restricted to) the following conditions

- The interiors of flues or chimneys are not inspected.
- Firescreens, fireplace doors, appliance gaskets and seals, automatic fuel feed devices, mantles and fireplace surrounds, combustion make-up air devices, and heat distribution assists (gravity or fan-assisted) are not inspected.
- The inspection does not involve igniting or extinguishing fires nor the determination of draft.
- Fireplace inserts, stoves, or firebox contents are not moved.
- The adequacy of the fireplace draw is not determined during a visual inspection; for safety reasons, if no fire is burning we do not ignite fires nor light paper or other materials.

Other Fireplace/Stove Components Not Inspected:

- Interiors of flues or chimneys

Please also refer to the pre-inspection contract for a detailed explanation of the scope of this inspection.